speedometer





Thank you for purchasing KOSO GP style speedometer, before operating the unit, please read the instruction thoroughly and retain it for the future reference.

∧ Notice

- 1. The meter is apply for **DC 12V**.
- 2. For installation, please follow the steps described in manual. Any damage caused by wrong installation shall be imputed to the users.
- 3.To avoid the short circuit, please don't pull the wire when installing. Don't break or modify the wire terminal.
- 4.Do not disassemble or change any parts excluding the manual description.
- 5. The interior examination or maintenance should be executed by our professionals.

SYMBOL NOTE:


NOTE You could get the installation details from the information behind the mark.

↑ Some processes must be followed to avoid the affection caused by wrong installation.

A WARNING Some processes must be followed to avoid damages to yourself or the public.


A CAUTION! Some processes must be followed to avoid the damage to the vehicle.

1-1 Accessory












13 M4 X P0.7 nut X 2



17 Aluminum bush X 1




2 Significant X 1




























4. Connect terminal X 3

8 2.5 mm spanner X 1


NOTE Please contact the local distributor if the items you open are not the same, with the above-listed one.

1-2 Option accessory
















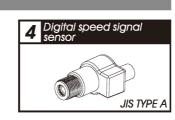




2-1 Wiring installation instructions

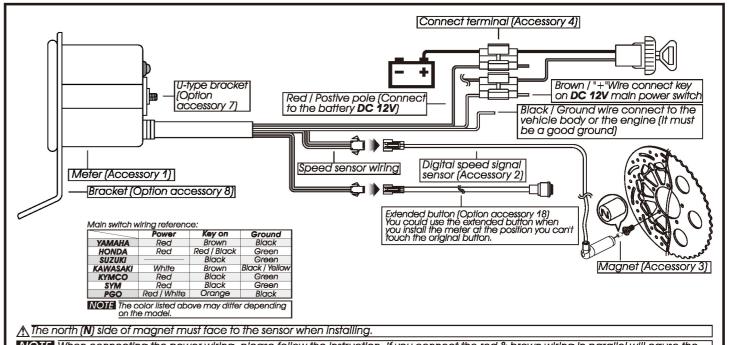

NOTE When connecting the power wiring, please follow the instruction. If you connect the red & brown wiring in parallel will cause the meter work improperly.

2-2 Installation instructions

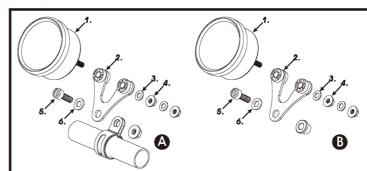


hen installing, please follow the process.

- 1. Meter (Accessory 1)
- Meter bracket (Accessory 9)
- 3. M4 washer X 2 (Accessory 15) 4. M4 X P0.7 nut X 2 (Accessory 13)
- 5. M6 X P1.0 screw (Accessory 14)
- 6. M6 washer (Accessory 16)
- Ouse the meter bracket (Accessory 9), handle bar clamp (Accessory 10), rubber (Accessory 11) and the nut to install the speedometer on the handle bar.
- Use the aluminum bush(Accessory 17) to install the speedometer on the handle bar stem.

2-3 Installation instructions








Install the s type sensor bracket.



Adjust the sensor bracket position to make sure that the sensor could face the magnet to prevent bad speed signal or no signall



Install the speed sensor on the bracket.



Adjust the distance between sensor and magnet. We suggest you to make sure the distance is under 8 mm for catching good speed signal.



The more magnet sensor points are, the less the display interval is, when installing the magnet, please put the magnet with **N**-mark side face the outside and put them averagely to avoid wrong signal.

EX. 1: If your disk has 3 screws, you could install 1 or 3 magnets to catch the speed.

EX. 2: If your disk has 4 screws, you could install 1 \cdot 2 or 4 magnets to catch the speed

EX. 3: If your disk has 5 screws, you could install 1 or 5 magnets to catch the speed.
EX. 4: If your disk has 6 screws, you could install 1 \cdot 2 \cdot 3 or 6 magnets to catch the speed.

After finishing the magnet installation and sensor point setting, please move your tire to test the speedometer work or not.









3-1 Basic function instruction

Odo meter

 Display range: 0~99999 km (mile), reset automatically after 99999 km (mile).


Display unit: 1 km (mile)


Trip meter

●Display range: 0~999.9 km (mile), reset automatically after 999.9 km (mile). •Display unit: 0.1 km (mile)



Speedometer Display range:0~160 km/h (MPH)Display unit: 1 km/h (MPH)





Adjust button

In the main screen, Press the Adjust button to switch between odometer and trip meter.
 In the trip meter screen, Press down the Adjust button for 3 seconds to reset the trip meter.

3-2 Function, setting instruction

■Speedometer	Display range: 0~160 km/h (MPH)	○Tire circumference setting Setting range: 300~2,500 mm Setting unit: 1 mm · Sensor point: 1~6		
	Display unit: 1 km/h (MPH)			
ODIsplay Internal	< 0.5 second	■Effective voltage	DC12V	
ODO meter	Display range:0~99999 km (mile) reset	●Effective temperature range	-10~+60°C	
	automatically after 99999 km (mile) . Display unit: 1 km (mile)	Meter standard	JIS D 0203	
		●Meter size	D48 X 53.2 mm	
○Trlp	Display range:0~999.9 km (mile) reset	Meter weight	Around 132.2 g	
	automatically after 0~999.9 km (mile)			
	Display unit: 0.1 km (mile).			

NOTE Design and specification are subject to change without notice!

NOTE If you enter the setting screen for 30 seconds and don't press the button, it will back to the main screen automatically.

4-1 MAIN SCREEN FUNCTION SWITCH INSTRUCTION

●4-1-1 Adjust button function instruction




Press Adjust button once to switch function from ODO to trip.


In main screen, you could press down the Adjust button for 3 seconds to change the speed unit.



NOTE External switch can be used as Adjust button to change the function display













• The main screen.

● 4-1-2 Adjust+Select button function instruction (Tire circumference, sensor position)



Press and hold both Adjust and Select buttons for 3 second to enter tire circumference setting screen. (Check section 4-2 for detail)



NOTE Do not enter into setup function when car is running

4-2 Tire circumference and sensor position setting




●EX: The tire circumference is 1300mm
■Press **Select button** to move to the digital you would like to set, Current tire is setting by 1000mm circumference.


1.Please measure the tire circumference (The tire you will install the sensor on) and make sure the number of magne sensor point (You could install the magnet into the disc screw or the sprocket screw)
2.The tire circumference can be set is flashing now.

NOTE 1. Tire circumference setting range: 300~2,500mm

2. Adjust unit: per 1 mm









setting screen.



EX: we would like set 16 sensor point on bike Press Adjust button to select the digital you

↑ The sensor point setting screen are flashing

NOTE 1. Sensor point setting range: 1~60 point. 2. Adjust range: 1 point.



■The sensor setting was change for 1P to 16P Press **Select button** to back to main screen.



The main screen.

5 Trouble shooting

The following situation do not indicate malfunction of the meter. Please check the following before taking it in for repair.

Trouble	Check item	Trouble	Check item
The meter doesn't work when the power is on. The meter shows wrong information.	 The power doesn't supply to the meter. →Please make sure the wiring is connected. The wiring and fuse are not broken. →The battery is broken or the battery is too old to supply enough power (DC 12V) to make the meter work. Please check the voltage of your battery, and make sure the voltage is over DC 12V. 	or appear incorrectly.	 Please make sure the speed sensor is connected correctly. Please check the tire-size setting. →please refer to the manual 4-1.
Wife still comit solve the pro	L	Contract with distributors or	

wh485ba004-B